



Inspection Convertible Gocarz

conducted for

M3XWC

Réalisé le / Conducted on :

11 May 2018 12:38 PM

Nom de l'inspecteur / Inspector's name :

Gocarz France - Dmitrij

Localisation / Location :

Carson Road

Cockfosters

Barnet

EN49EX

Marque & Modèle de véhicule / Car's Make & Model

BMW M3 E46

Completed on


11 May 2018 03:13 PM

Score

23/27.0 - 85.19%

Failed Responses

This section lists responses that were set as "failed responses" in the template used for this audit

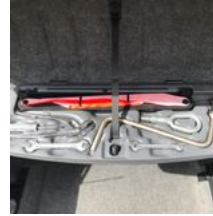Question	Response	Details
Véhicule repeint / Resprayed vehicle ?	visible	
Le coffre souffre-t-il de déformations, réparations ou corrosion / Boot showing signs of deformations, repairs or corrosion ?	Yes	Boot are ok for age, carpet got some marks and handle on inside of boot floor cover got crack on plastic housing. Chassis in boot looks good, visible repairs on top where the subframe and main chassis joins. So as the seller stated this car had strengthening welds done by the garage.
      Appendix 42 Appendix 43 Appendix 44 Appendix 45 Appendix 46 Appendix 47		
      Appendix 48 Appendix 49 Appendix 50 Appendix 51 Appendix 52 Appendix 53		
      Appendix 54 Appendix 55 Appendix 56 Appendix 57 Appendix 58 Appendix 59		
   Appendix 60 Appendix 61 Appendix 62		

Carrosserie / Bodywork

Question	Response	Details
----------	----------	---------

Question	Response	Details
Condition de la carrosserie / Bodywork condition ?	Moyen / Medium	Bodywork - car had full respray, job not bad, 7/10 but considering the age its fairly clean and looks nice and shiny In detail: bodywork respray not perfect, the actual preparation before repaint was rough and you can see it through the paint if come close, but car does look really clean from outside and shiny! So if you dont mind about being an investigator of whats hidden under the paint coat, then its nothing to worry about. Possible repairs on rear of car, also most likely during the respray job all minor dents and dints was filled on most body panels to bring back a better look, but you dont see any of that if not going very close and look with professional eyes. Bootlid disalighned slightly with a bit bigger gap on left side Very minor marks on bodywork on most panels, but nothing major, mainly very light stonechips and few dints, not even dents Near areal some paint chepped off Wing mirrors glass starting to become defective from age Left mirror holder plate have corrosion under paint , I think the plate is from alloy, so it may not been prepared very good before respray. But its easy job to repaint, if you take mirror off and sand it off then respray.



Appendix 1



Appendix 2



Appendix 3



Appendix 4



Appendix 5



Appendix 6




Appendix 7



Appendix 8




Appendix 9

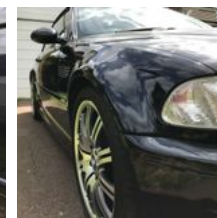

Appendix 10



Appendix 11

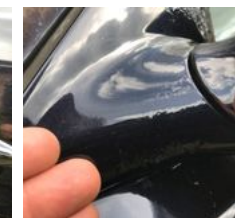

Appendix 12



Appendix 13



Appendix 14




Appendix 15



Appendix 16



Appendix 17

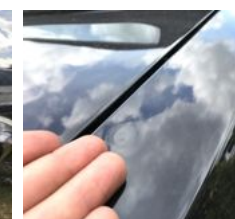

Appendix 18

Question	Response	Details
Trace d'accident / Sign of accident ?	possible	Possibly had light tap on rear as bootlid not aligns against rear wings
  Appendix 40 Appendix 41		
Véhicule repeint / Resprayed vehicle ?	visible	

Question	Response	Details
Le coffre souffre-t-il de déformations, réparations ou corrosion / Boot showing signs of deformations, repairs or corrosion ?	Yes	Boot are ok for age, carpet got some marks and handle on inside of boot floor cover got crack on plastic housing. Chassis in boot looks good, visible repairs on top where the subframe and main chassis joins. So as the seller stated this car had strengthening welds done by the garage.
      Appendix 42 Appendix 43 Appendix 44 Appendix 45 Appendix 46 Appendix 47		
      Appendix 48 Appendix 49 Appendix 50 Appendix 51 Appendix 52 Appendix 53		
      Appendix 54 Appendix 55 Appendix 56 Appendix 57 Appendix 58 Appendix 59		
   Appendix 60 Appendix 61 Appendix 62		

Question	Response	Details
Etat de la capote / Condition of soft or hard top ?	Moyen / Medium	Cabrio roof needs clean from outside with conditioner to bring black colour back.. its not bad though comparing to others Inside of interior the cabrio roof lining on right side not intact Cabrio roof does not operate from switch inside of car, but it works from outside by key in door lock Seller said it was working until 3 weels ago, then he mafe a research and on forums it stated that it may need a reset for the switch, or switch needs replacing. Either way, roof mechanism needs a service to check that it works for years to come.
             		

Soubassements, Chassis / Underbody

Question	Response	Details
----------	----------	---------

Question	Response	Details
Corrosion du châssis / Chassis corrosion ?	Bien / Good	Under chassis most covered with plastic shields, but as far as I could see, it all looks good! Minor corrosion in some places, but all very solid and no visible damage! Under rear subframe same as in boot, it can be seen repairs with some sort of plates welded on to add strength! Exhaust system got corrosion, but sounds ok, only thing is near exhaust headers possibly slight blow as if to listen from bottom of car ticking sound comes more from that side.. can not see much from ground, so this would needs to be looked on ramps. Suspension, diff, all looks ok for that age and mileage. Rubbers got aging, but looks all intact. Minor corrosion on all parts, but nothing excessive. Dont see any oil leaks from underneath, all looks dry.



Appendix 77




Appendix 78



Appendix 79




Appendix 80

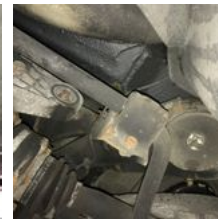

Appendix 81



Appendix 82

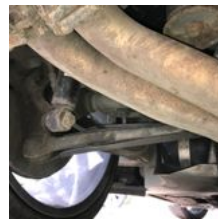

Appendix 83



Appendix 84



Appendix 85



Appendix 86



Appendix 87




Appendix 88



Appendix 89



Appendix 90

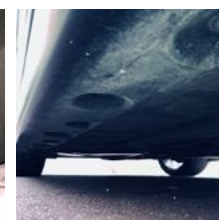

Appendix 91




Appendix 92




Appendix 93




Appendix 94

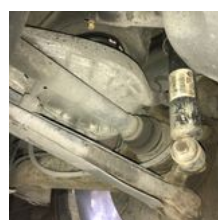

Appendix 95

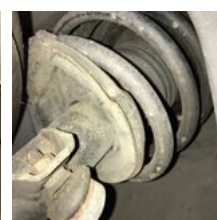

Appendix 96

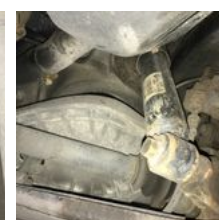

Appendix 97








Appendix 98



Appendix 99







Appendix 100

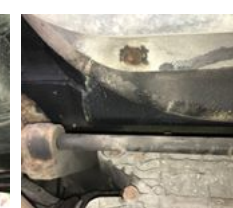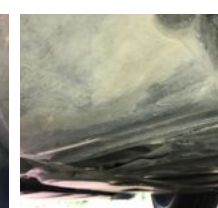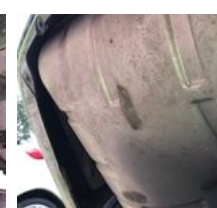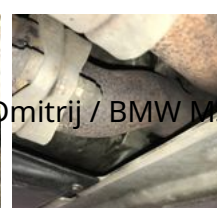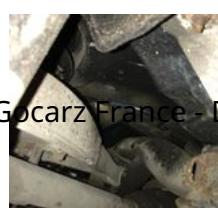


Question	Response	Details
Trace de fuite d'huile / Sign of oil leak?	non visible	

Consommables & Fluides / Consumables & Fluids - 2/2 100.00%

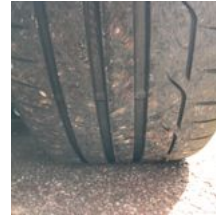Question	Response	Details
Roue de secours - galette en bon état / Spare wheel in good condition ?	N/A	No spare wheel available from factory, but repair kit in car, however needs checking as might be out of date!
  Appendix 116 Appendix 117		
Etat des pneus avant / Front tyres condition :	à prévoir / to do at next service	Wheels got marks, curbs, scratches, but looks straight and ok for age. Tyres I would recomend to change soon, because fronts starting to crack from age, but still got approx 4mm of tread
      Appendix 118 Appendix 119 Appendix 120 Appendix 121 Appendix 122 Appendix 123		
  Appendix 124 Appendix 125		
Pneus avant identiques / Front matching tyres ?	Yes	

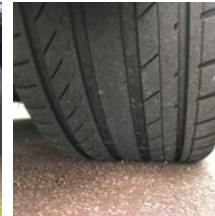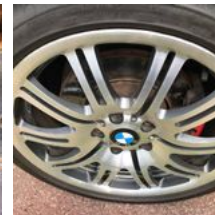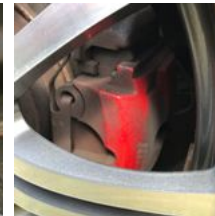Question	Response	Details
Etat des pneus arrière / Rear tyres condition :	à prévoir / to do at next service	Wheels got marks, curbs, scratches, but looks straight and ok for age. Tyres I would recommend to change because very close to limit in centre! But still can be used, just not advised!
       		
Pneus arrières identiques / Rear matching tyres ?	Yes	
Freins avant / Front brakes	à prévoir / to do at next service	Front brake discs need to be changed very soon! Brake pads are good! If you want to keep the car for long time, then need set of brakes with pads recommended!
         		

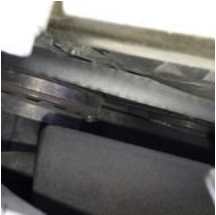
Question	Response	Details
Freins arrière / Rear brakes	à faire vérifier / to be checked	Rear discs a bit better, but got wear and groove with not even wear. Pads are ok. If you want to keep the car for long time, then nee set of brakes with pads recommended!
Liquide de frein / Brake fluid	OK	
  Appendix 144 Appendix 145		
Etat des courroies / Belts condition (timing & auxiliary):	à faire vérifier / to be checked	Belts would need further check when car is on ramps. Timing chain sound ok, no excessive noise
   Appendix 146 Appendix 147 Appendix 148		
Huile moteur (état - niveau) / Engine oil (condition - level)	OK	Oil looks good
   Appendix 149 Appendix 150 Appendix 151		

Question	Response	Details
Liquide de refroidissement (état - niveau) / Coolant (condition - level)	OK	
  Appendix 152 Appendix 153		
Huile de BV (état - niveau) / Gearbox oil (condition - level)	à faire vérifier / to be checked	No access, needs to be checked when on ramps

Mécanique / Mechanic - 6/9 66.67%

Question	Response	Details
Baie moteur accessible / Engine bay accessible ?	Yes	


Question	Response	Details
Etat général baie moteur / General condition engine bay ?	Bien / Good	Engine bay looks fully original and unmodified. Fairly clean for the age and mileage of the car at 95k miles. Usual dust, minor dirt and very minor rust spots in some places. No visible oil leaks and engine looks clean. Engine starts on cold and hot as it should! Engine works and sounds ok, no strange noises or bangs, only slight ticking and tapping from cylinder head valve train. Its not perfect, but good for the mileage it have. No smoke from oil filler cap, only very slight puf, but oil got warm, so it all good! No smoke from exhaust either, only minor condensation, so its all sounds good! Engine revs up nice and sharp! Engine ticking sound, not major and probably will still be there after you done 100k and will not affect anything. Power steering reservoir bottle is greasy and steering fluid pipes are covered in grease. This is common and not a problem, it was building up iver long period and knowns as hoses do get very slight leak near connections with bottle, but usually its so luttle, that can go for years without the need to top up the fluid. However when car be on ramps, I would advise to double check from underneath and try to tighten the hoses. Also clean them so if there be any nee leaks, then it can be tracked easier.

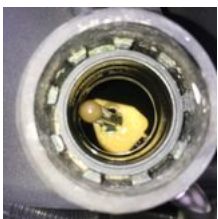

Appendix 154




Appendix 155

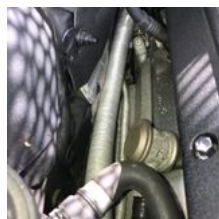

Appendix 156



Appendix 157

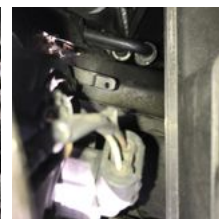

Appendix 158



Appendix 159



Appendix 160



Appendix 161



Appendix 162




Appendix 163



Appendix 164



Appendix 165

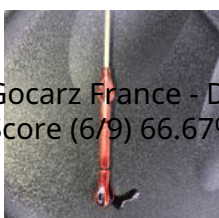

Question	Response	Details
Vidéo moteur tournant / Video running engine (cold & warm)	☒	
Vidéo gaz d'échappement / Video exhaust gas	☒	
Diagnostic électronique / Electronic Diagnostic		
Code(s) erreur trouvés / Fault code(s) found ?	No	
  Appendix 189 Appendix 190		
Essai routier / Test drive		
Conditions	10 - 15 min, sec / dry, ville / town roads	
Moteur / Engine (Bruits , vibrations, fumées / Noises, vibrations, smoke) :	OK	Test drive - dry, town roads up to 50mph 10-15min Car drives good, everything feels good, steering, suspension, gearbox, all feels as it should! Engine feels strong, picks up the revs nicely with plenty of torque and goes very fast once hits the rev range over 5k rpm, so in overall test drive is positive!
Transmission (Bruits , vibrations, fumées / Noises, vibrations, smoke) :	OK	
Suspensions (Condition) :	OK	
Ressenti direction / Steering wheel abnormal sensations ?	Safe	

Intérieur - Electronique / Interior - Electronics - 9/10 90.00%

Question	Response	Details
----------	----------	---------


Question	Response	Details
Etat de l'intérieur / Interior condition ?	Moyen / Medium	Interior - not perfect, needs a good clean, seller did not prepare car for sale, so with full wallet it would look much better. Mainly downpoints are usual wear and tear to most parts, scratches on all plastics and leather. Driver seat have more wear on side edge and slight split on stitching, but this can be repaired by stitching it up. Tv screen got some dead pixels AC seems all working as it should Left rear window seal have rubber bit missing on top Cabrio roof needs clean from outside with conditioner to bring black colour back.. its not bad though comparing to others Inside of interior the cabrio roof lining on right side not intact



Appendix 191



Appendix 192

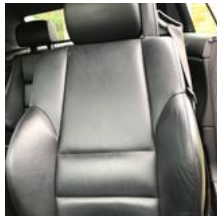

Appendix 193



Appendix 194



Appendix 195



Appendix 196



Appendix 197




Appendix 198



Appendix 199



Appendix 200

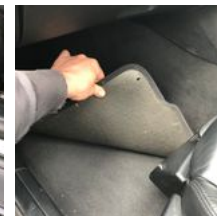


Appendix 201



Appendix 202




Appendix 203

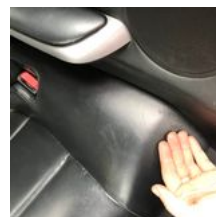

Appendix 204



Appendix 205

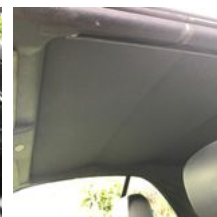

Appendix 206



Appendix 207



Appendix 208




Appendix 209




Appendix 210



Appendix 211

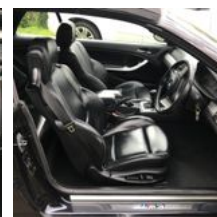


Appendix 212

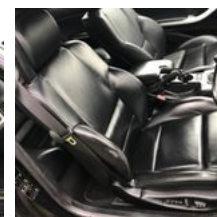

Appendix 213



Appendix 214

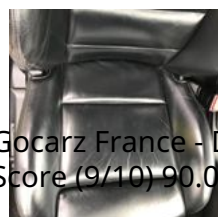

Appendix 215




Appendix 216



Appendix 217



Appendix 218

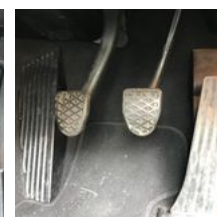


Appendix 219



Appendix 220

Question	Response	Details
Mileage (Miles)	95k	
Témoins allumés / Dashboard lights on ?	No	
Klaxon fonctionnel / Horn working ?	Yes	
Fermeture centralisée fonctionnelle / Central locking working ?	Yes	
Fenêtres électriques fonctionnelles / Electric windows working ?	Yes	
Rétro. électriques fonctionnels / Electric mirrors working ?	Yes	
Unité centrale fonctionnelle / Head unit working ?	Yes	Dead pixels on screen!
Essuis glace fonctionnels / Wipers working ?	Yes	
Eclairage fonctionnel / All lights working ?	Yes	All lights looks ok, usual stonechips on fronts, but no cracks or damage. Headlights lenses may benefit from polishing. And side indicators got usual yellowing.
Ouverture - Fermeture de toutes les portes / All doors opening - closing ?	Yes	
Ceintures de sécurité fonctionnelles / Seatbelts fastening - unfastening ?	Yes	
Parre-brise - fenêtres - rétroviseurs intacts / Windshield - windows - mirrors free from cracks ?	No	Mirror both glass got ageing marks Windscreen got several stone chips in different places, but no visual cracks at moment Stone chips may need get treated by glass specialist so they dont crack

Administratif - 6/6 100.00%

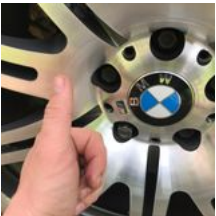Question	Response	Details
Nombre de clefs / Number of keys ?	1	
Toutes les clefs fonctionnelles / All keys working ?	Yes	
  Appendix 249 Appendix 250		
Ecrou antivol présent / Locking nut available ?	Yes	
  Appendix 251 Appendix 252		
HPI check (base de donnée des assurances) :	N/A	
Cat D signifie que le coût des réparations des dommages subits est inférieur au prix argus du véhicule, Cat C le coût des réparations dépasse le prix argus, Cat B le véhicule peut être vendu en pièces détachées uniquement et enfin Cat A, le véhicule ne peut être que détruit.		

Question	Response	Details
Correspondance VIN / Matching VIN (chassis, V5, pare-brise / windshield) :	Yes	
     		
  		
V5 disponible / Available V5 ?	Yes	
CT à jour / MOT up to date ?	Plus de 6 mois (6months+)	Seller stated that he will put new mot on car
Carnet d'entretien et-ou factures vérifiés / Service book and-or invoices checked ?	☒	
CERFA cession rempli / French certificate of sale filled-up ?	☒	
Signature (for inspectors only)		
	Dmitrij	11 May 2018 03:12 PM
		

Media



Appendix 1



Appendix 2



Appendix 3



Appendix 4



Appendix 5



Appendix 6



Appendix 7



Appendix 8



Appendix 9



Appendix 10



Appendix 11



Appendix 12



Appendix 13



Appendix 14



Appendix 15



Appendix 16



Appendix 17



Appendix 18



Appendix 19



Appendix 20



Appendix 21



Appendix 22



Appendix 23



Appendix 24



Appendix 25



Appendix 26



Appendix 27



Appendix 28



Appendix 29



Appendix 30



Appendix 31



Appendix 32



Appendix 33



Appendix 34



Appendix 35



Appendix 36



Appendix 37



Appendix 38



Appendix 39



Appendix 40



Appendix 41



Appendix 42



Appendix 43



Appendix 44



Appendix 45



Appendix 46



Appendix 47



Appendix 48



Appendix 49



Appendix 50



Appendix 51



Appendix 52



Appendix 53



Appendix 54



Appendix 55



Appendix 56



Appendix 57




Appendix 58



Appendix 59



Appendix 60

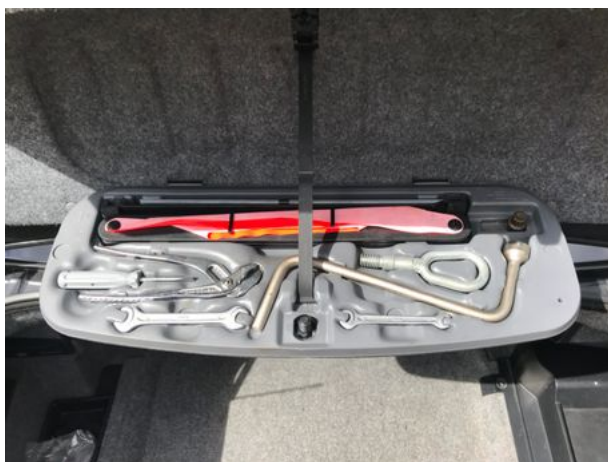

Appendix 61



Appendix 62



Appendix 63



Appendix 64



Appendix 65



Appendix 66



Appendix 67



Appendix 68



Appendix 69



Appendix 70



Appendix 71



Appendix 72



Appendix 73



Appendix 74



Appendix 75



Appendix 76



Appendix 77



Appendix 78



Appendix 79



Appendix 80



Appendix 81



Appendix 82



Appendix 83



Appendix 84



Appendix 85




Appendix 86



Appendix 87



Appendix 88

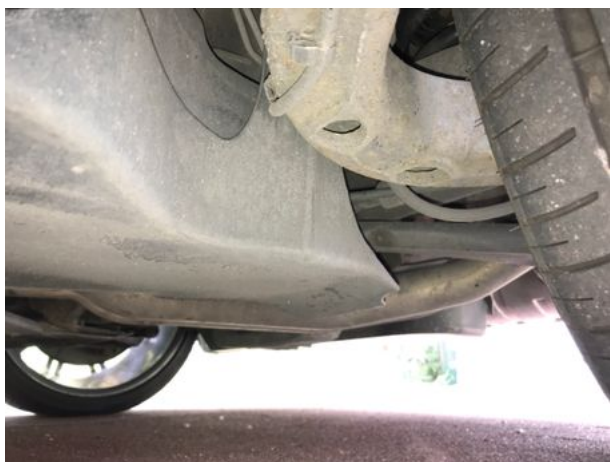

Appendix 89



Appendix 90



Appendix 91



Appendix 92



Appendix 93




Appendix 94



Appendix 95



Appendix 96

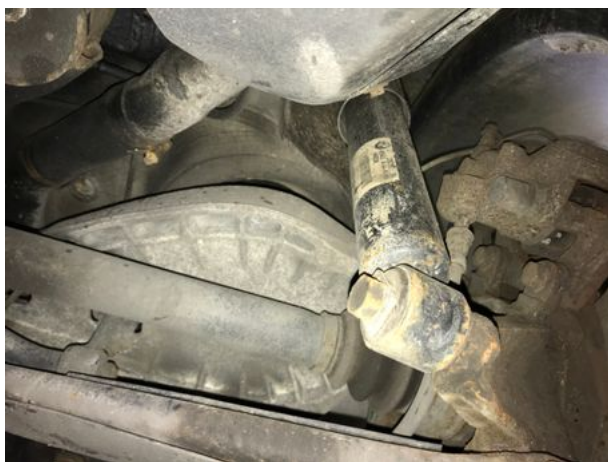

Appendix 97



Appendix 98



Appendix 99



Appendix 100



Appendix 101



Appendix 102



Appendix 103



Appendix 104



Appendix 105



Appendix 106



Appendix 107



Appendix 108



Appendix 109



Appendix 110



Appendix 111



Appendix 112



Appendix 113



Appendix 114




Appendix 115



Appendix 116



Appendix 117

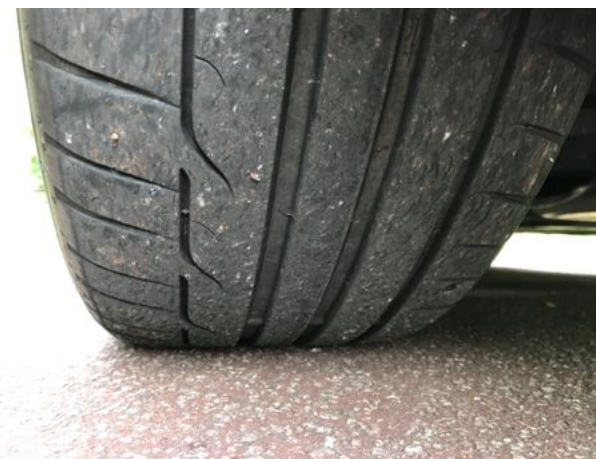


Appendix 118



Appendix 119



Appendix 120

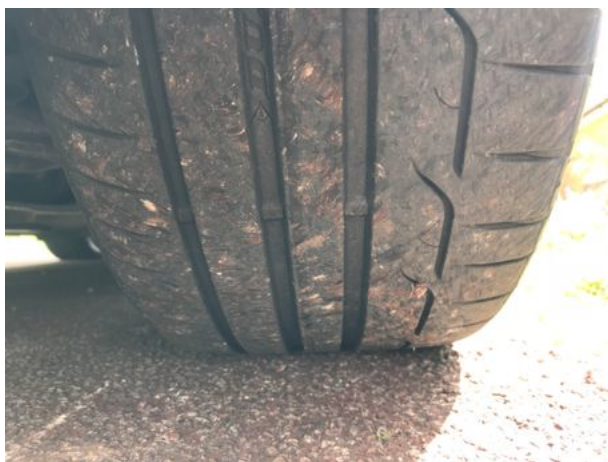

Appendix 121



Appendix 122



Appendix 123



Appendix 124



Appendix 125



Appendix 126



Appendix 127



Appendix 128



Appendix 129



Appendix 130



Appendix 131



Appendix 132



Appendix 133



Appendix 134



Appendix 135



Appendix 136



Appendix 137



Appendix 138



Appendix 139



Appendix 140



Appendix 141



Appendix 142



Appendix 143



Appendix 144



Appendix 145



Appendix 146



Appendix 147



Appendix 148



Appendix 149



Appendix 150




Appendix 151



Appendix 152



Appendix 153

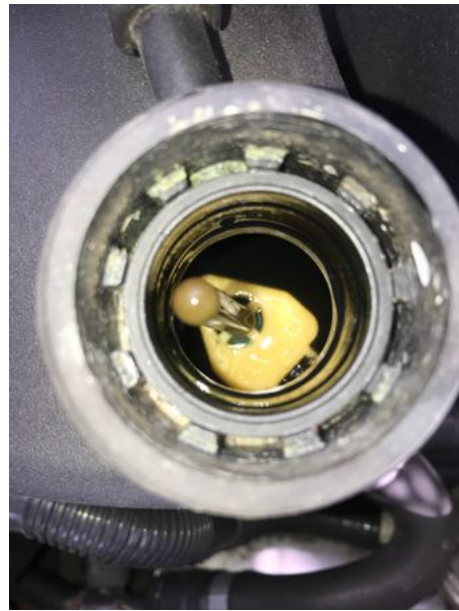

Appendix 154



Appendix 155



Appendix 156



Appendix 157



Appendix 158



Appendix 159



Appendix 160



Appendix 161



Appendix 162



Appendix 163



Appendix 164



Appendix 165



Appendix 166



Appendix 167

Appendix 168

Appendix 169



Appendix 171

Appendix 170



Appendix 172



Appendix 173



Appendix 174



Appendix 175



Appendix 176



Appendix 177



Appendix 178



Appendix 179



Appendix 180



Appendix 181



Appendix 182



Appendix 183



Appendix 184



Appendix 185



Appendix 186



Appendix 187



Appendix 188



Appendix 189



Appendix 190



Appendix 191



Appendix 192



Appendix 193



Appendix 194



Appendix 195



Appendix 196



Appendix 197



Appendix 198



Appendix 199



Appendix 200



Appendix 201



Appendix 202



Appendix 203



Appendix 204



Appendix 205



Appendix 206



Appendix 207



Appendix 208



Appendix 209



Appendix 210



Appendix 211



Appendix 212



Appendix 213



Appendix 214



Appendix 215



Appendix 216



Appendix 217



Appendix 218



Appendix 219



Appendix 220



Appendix 221



Appendix 222



Appendix 223



Appendix 224



Appendix 225



Appendix 226



Appendix 227



Appendix 228



Appendix 229




Appendix 230



Appendix 231



Appendix 232

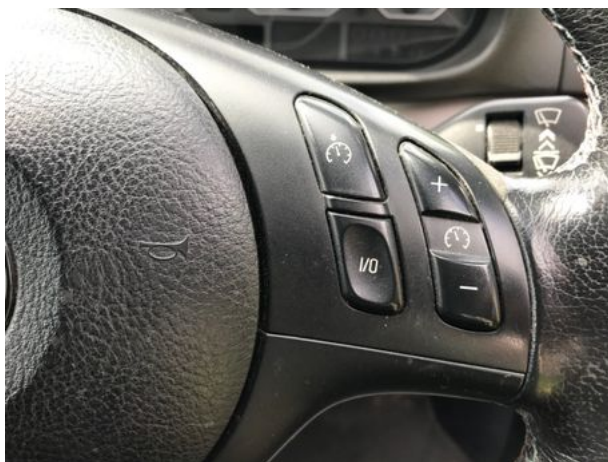

Appendix 233



Appendix 234




Appendix 235



Appendix 236



Appendix 237

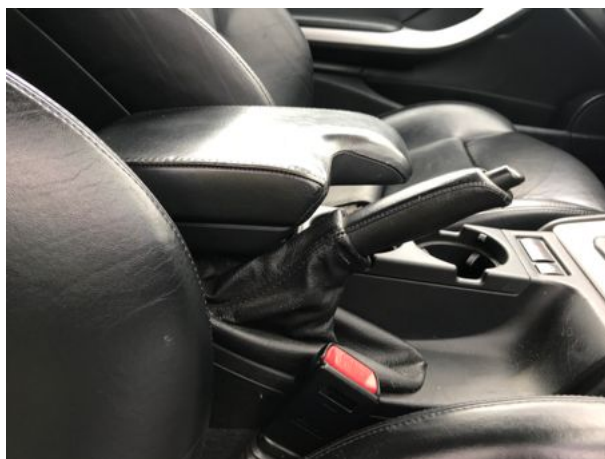

Appendix 238



Appendix 239



Appendix 240



Appendix 241



Appendix 242



Appendix 243



Appendix 244



Appendix 245



Appendix 246



Appendix 247



Appendix 248



Appendix 249




Appendix 250



Appendix 251



Appendix 252

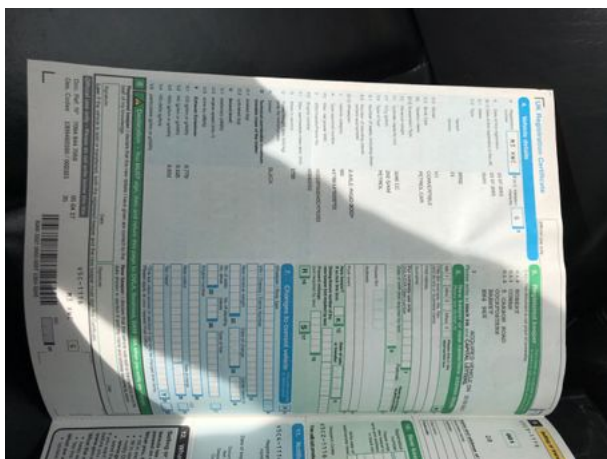

Appendix 253



Appendix 254



Appendix 255




Appendix 256



Appendix 257



Appendix 258

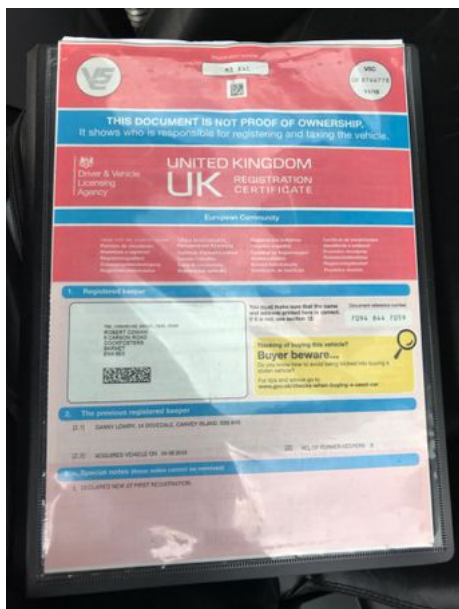

Appendix 259



Appendix 260

